



Meridian Audio Limited
Latham Road, Huntingdon
Cambridgeshire PE29 6YE
United Kingdom

T +44(0)1480 445678
F +44(0)1480 445686
E info@meridian.co.uk
www.meridian-audio.com

Technical Note TN8


3rd October 2008

F80 internal-fuse replacement for use with i80

F80s with serial numbers lower than 10004000 require a modification to allow the product to charge an iPod® when used in conjunction with i80.

The modification requires an internal fuse to be exchanged for an uprated type. This fuse is a small yellow disc-like component soldered onto the main PCB. The F80 must be disassembled in order to carry out the modification. Disassembly instructions are available from Meridian on Technical Note **TN9**.

Once the main PCB has been removed, the relevant component can be found close to the multi-way "Mini-DIN" socket used for connection to the i80.

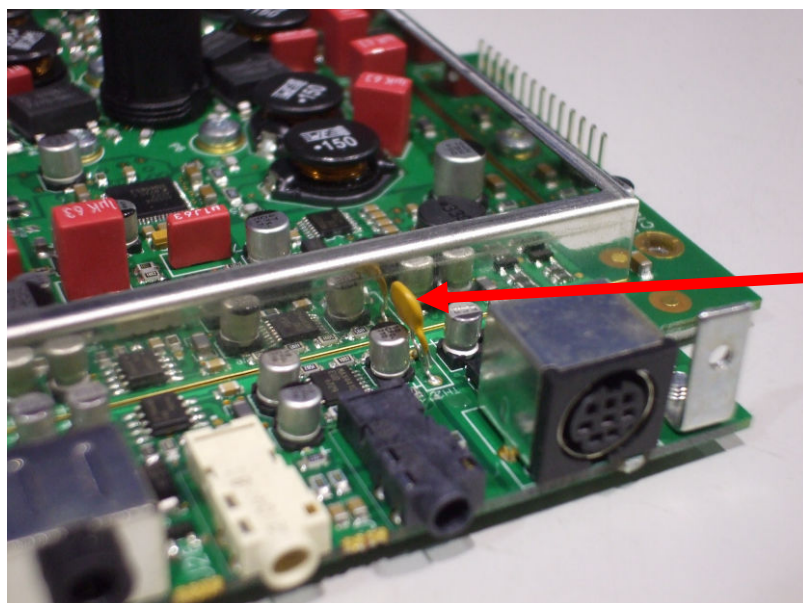

Fuse to be replaced

The uprated fuse can be obtained from Meridian using the following part-number and/or description:

C20136 - fuse polyswitch 0.3 amp

iPod is a trademark of Apple Inc., registered in the U.S. and other countries.

A member of the Meridian Group of companies
Registration No 2710631 Registered office as above